

**ELITE JET GROUP**

## 1992 Boeing 757-200 Executive



Specification and Status Summary

*Boeing 757-222ER*

*MSN26647*

**WWW.ELITEJETGROUP.COM**

**\$6.5 MILLONES US**

# Specification and Status Summary



## Boeing 757-222ER (Winglets)

Manufacturer's Serial Number  
26647

Registration Number  
N758SS

### Table of Contents:

|                      |         |
|----------------------|---------|
| Specifications ..... | Page 1  |
| Status Summary ..... | Page 3  |
| Interior .....       | Page 4  |
| Images .....         | Page 5+ |

*No warranty is made or implied as to the completeness or accuracy of the data presented herein, which is subject to change. Buyer or lessee may verify via inspection of aircraft and aircraft records as requested.*

**WWW.ELITEJETGROUP.COM**



# SPECIFICATIONS

Boeing 757-222ER

**Summary**

|                             |                             |
|-----------------------------|-----------------------------|
|                             | <b>MSN 26647</b>            |
| Current Registration Number | N758SS                      |
| Minor Variant               | -22ER                       |
| Date of Manufacture         | April 1992                  |
| Manufacture Line Number     | 442                         |
| Total Hours Since New       | <b>76,071.30</b>            |
| Total Cycles Since New      | <b>22,355.00</b>            |
| Noise Category Compliance   | FAR Part 36, Stage III      |
| Usable Fuel                 | 11,276 Gallons ; 75,550 lbs |

**Weights<sup>1</sup>**

|                                |   |
|--------------------------------|---|
| Max. Taxi Weight               | 241,000 lbs ; 109,316 kg                              |
| Max. Take Off Weight           | 240,000 lbs ; 108,862 kg                              |
| Max. Landing Weight            | 198,000 lbs ; 89,811 kg                               |
| Aircraft Weigh (3 YR Interval) | Last Accomplished: 06/28/2019<br>Next Due: 06/28/2022 |

**Engines 1 & 2**

|                                   |             |
|-----------------------------------|-------------|
| Make                              | Rolls Royce |
| Model                             | RB211-535C  |
| Stage III / Chapter III Compliant | Yes         |

**Interior**

|                     |   |
|---------------------|---|
| Galleys             | 1 Fwd G 1A/G 1B ; 1 Mid G 2A ; 1 Aft G 4B |
| Lavatories          | 1 Fwd, 1 Mid and 2 Aft                    |
| VIP Club Seating    | 24  |
| First Class Seating | 56  |
| <b>Total Seats</b>  | <b>80 PAX</b>                             |

**APU**

|               |               |
|---------------|---------------|
| Make          | Honeywell     |
| Model         | GTCP331-200ER |
| Serial Number | 61907         |
| TSN           | 27,266.00     |
| CSN           | 30,709.00     |

Boeing 757-222ER

Major Alterations List



|    | <b>STC#</b> | <b>Description</b>                  | <b>ICA</b> |
|----|-------------|-------------------------------------|------------|
| 1  | ST00007LB-D | UAL YAW DAMPER CKECK VALVE INSALL   | 1C         |
| 2  | ST00554LA-D | HONEYWELL ENHANCED GPWS             |            |
| 3  | ST00657SE   | BRITAX ATIX INTERIOR RETROFIT KIT   | 1C         |
| 4  | ST00825SE   | HONEYWELL RDR-\$B INSTALL           | 1C         |
| 5  | ST01334LA   | C&D COCKPIT DOOR INSTALL            | 6A         |
| 6  | ST01518SE   | APB WINGLET INSTALL                 |            |
| 7  | ST02261LA-D | UAL INSTALL 2 HR CVR                |            |
| 8  | ST02221AT   | SAF-T-GLO EEPLS SYSTEM              | SERV CH    |
| 9  | 8110/3337   | INSTALL GOGO ATG8000                |            |
| 10 | 8110/337    | RECONFIGURE CABIN TO 80 PAX         |            |
| 11 | ST04415AT   | JETAIRE INVICTA IGNITION MITIGATION | 8C         |
| 12 | ST04011NY   | ADS-B OUT AERSALE                   | 1C         |



# STATUS SUMMARY

Boeing 757-222ER

Status Summary Date: 16-March-20

| <b>Summary</b>              |  | <b>MSN 26647</b> |
|-----------------------------|--|------------------|
| Current Registration Number |  | N758SS           |
| Total Hours Since New       |  | 76,071.30        |
| Total Cycles Since New      |  | 22,355.00        |

| <b>C Check Status</b> |               |                  |
|-----------------------|---------------|------------------|
| Last C Check Date     | June 28, 2016 | 4C Complied With |
| Next C Check Due      | June 28, 2020 | 1C Due           |


| <b>Engine 1 – SN 30086</b>   |             |
|------------------------------|-------------|
| Time Since New               | 40,020.96   |
| Cycles Since New             | 18,780.00   |
| Time Since Last Shop Visit   |             |
| Cycles Since Last Shop Visit |             |
| LLP Limiter                  | IP Disc     |
| Limiting Cycles              | <b>2231</b> |
| Current Status               | Serviceable |

| <b>Engine 2 – SN 30004</b>   |                  |
|------------------------------|------------------|
| Time Since New               | 41,230.50        |
| Cycles Since New             | 30,648.00        |
| Time Since Last Shop Visit   |                  |
| Cycles Since Last Shop Visit |                  |
| LLP Limiter                  | LP Turbine Shaft |
| Limiting Cycles              | <b>2,842</b>     |
| Current Status               | Serviceable      |

| <b>APU – SN 61907</b> |           |
|-----------------------|-----------|
| Time Since New        | 27,266.00 |
| Cycles Since New      | 30,709.00 |

| <b>Landing Gear Status</b> | <b>LH Main Landing Gear</b> | <b>RH Main Landing Gear</b> | <b>Nose Landing Gear</b> |
|----------------------------|-----------------------------|-----------------------------|--------------------------|
| Last Overhaul Date         | Sept. 17, 2014              | Sept. 17, 2014              | Aug 14, 2014             |
| Next Overhaul Date         | <b>Sept. 17, 2024</b>       | <b>Sept. 17, 2024</b>       | <b>Aug 14, 2024</b>      |

|                     |   |
|---------------------|---|
| Galleys             | 1 Fwd G 1A/G 1B ; 1 Mid G 2A ; 1 Aft G 4B |
| Lavatories          | 1 Fwd, 1 Mid and 2 Aft                    |
| VIP Club Seating    | 24  |
| First Class Seating | 56  |
| <b>Total Seats</b>  | <b>80 PAX</b>                             |

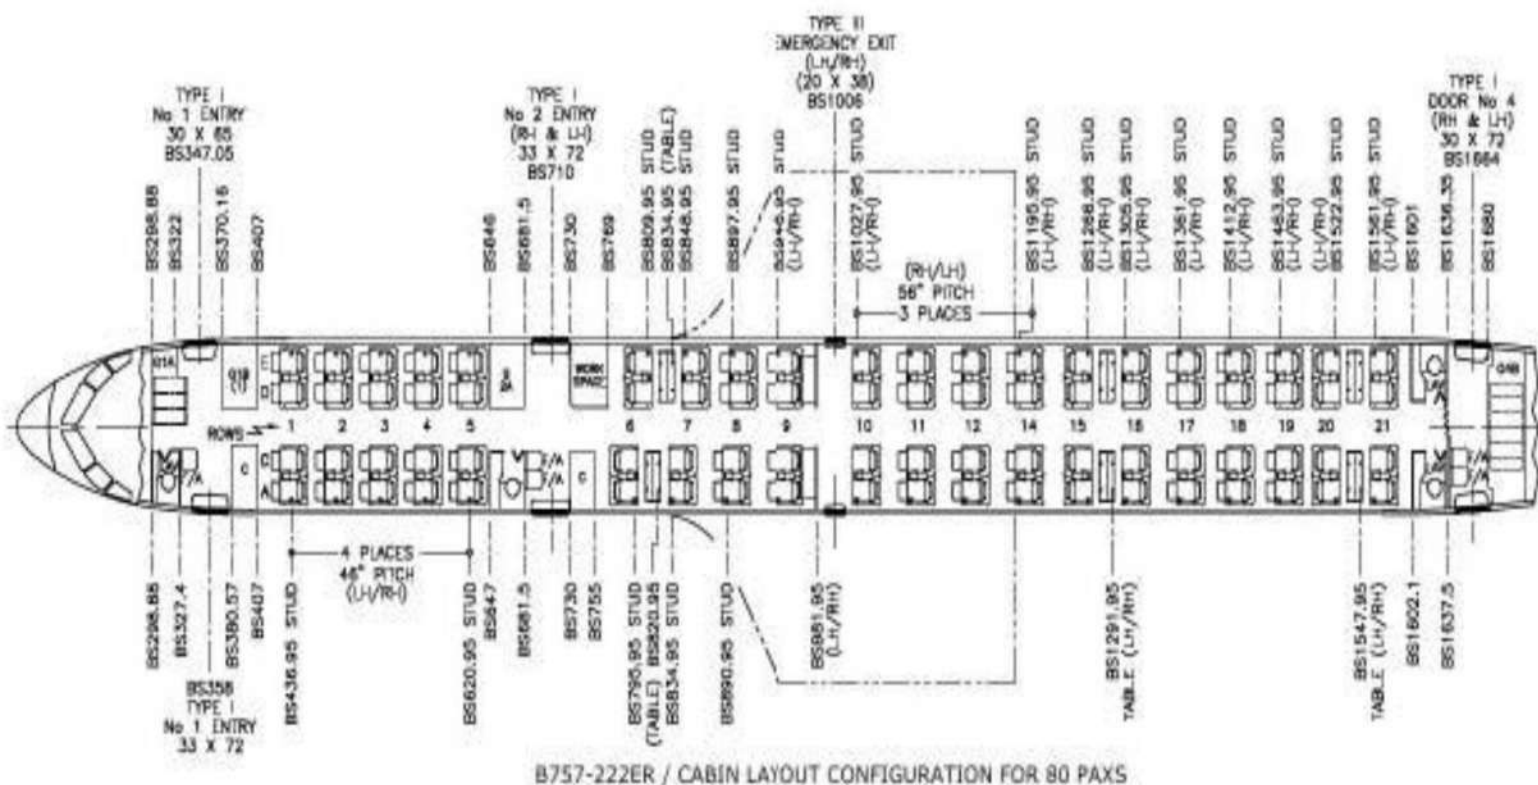

B757-222ER / CABIN LAYOUT CONFIGURATION FOR 80 PAXS



**ELITE JET GROUP**



[WWW.ELITEJETGROUP.COM](http://WWW.ELITEJETGROUP.COM)

**ELITE** ✶ **JET GROUP**



[WWW.ELITEJETGROUP.COM](http://WWW.ELITEJETGROUP.COM)



**ELITE** ✦ **JETGROUP**



[WWW.ELITEJETGROUP.COM](http://WWW.ELITEJETGROUP.COM)

### 0 - RB211-535C-37 / 30086 - Turbofan/ - Life/Overhaul Limit Report

| ATA Number                             | Description                        | Part Number        | Serial Number         | Position     | Status            | Next Due                              | Remaining |
|--|------------------------------------|--------------------|-----------------------|--------------|-------------------|---------------------------------------|-----------|
| Hours                                  | Date at Install                    | Date at Overhaul   | Hours Since Overhaul  | Start Date   | TBO Hours         | Part#:RB211-535C-37 Serial#:30086     |           |
| Cycles                                 | Hours at Install                   | Hours at Overhaul  | Cycles Since Overhaul | Limit Hours  | TBO Cycles        | Hours:28899.07 Cycles:12486.00 Other: |           |
| Other                                  | Cycles at Install                  | Cycles at Overhaul | Other Since Overhaul  | Limit Cycles | TBO Days          | Status:On Condition Part              |           |
|  | Other at Install                   | Other at Overhaul  |                       | Limit Days   | TBO Other         | Install Date:01/22/2018               |           |
| 72-10-00                               | Module 01, LP Compressor Fan       | M01605AB           | DM3090                | Only         | On Condition Part |                                       |           |
| TSN: 28899.07<br>CSN: 12486.00<br>OSN: | 01/15/1984                         |                    |                       |              |                   |                                       |           |
| 72-10-01                               | Disk, LP Compressor Rotor          | UL19579            | STDK3495/A            | Only         | Life Limit        |                                       |           |
| TSN: 28899.07<br>CSN: 12486.00<br>OSN: | 01/18/1984<br>0<br>0               |                    | 12500.00              |              |                   | 12500.00 C                            | 14.00 C   |
| 72-10-02                               | Blade, LP Compressor               | UL19649            | 1WKT                  | 01           | Life Limit        |                                       |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00 |                    | 16500.00              |              |                   | 16500.00 C                            | 2230.00 C |
| 72-10-02                               | Blade, LP Compressor               | UL19649            | 1UDB                  | 02           | Life Limit        |                                       |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00 |                    | 16500.00              |              |                   | 16500.00 C                            | 2230.00 C |
| 72-10-02                               | Blade, LP Compressor               | UL19649            | 1ZKS                  | 03           | Life Limit        |                                       |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00 |                    | 16500.00              |              |                   | 16500.00 C                            | 2230.00 C |
| 72-10-02                               | Blade, LP Compressor               | UL19649            | 1ZJX                  | 04           | Life Limit        |                                       |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00 |                    | 16500.00              |              |                   | 16500.00 C                            | 2230.00 C |



### 0 - RB211-535C-37 / 30086 - Turbofan/ - Life/Overhaul Limit Report

| ATA Number                             | Description  | Part Number  | Serial Number   | Position  | Status   | Next Due  | Remaining |
|--|--|--|---|---|--|---|-----------|
| Hours<br>Cycles<br>Other               | Date at Install<br>Hours at Install<br>Cycles at Install<br>Other at Install | Date at Overhaul<br>Hours at Overhaul<br>Cycles at Overhaul<br>Other at Overhaul | Hours Since Overhaul<br>Cycles Since Overhaul<br>Other Since Overhaul | Start Date<br>Limit Hours<br>Limit Cycles<br>Limit Days | TBO Hours<br>TBO Cycles<br>TBO Days<br>TBO Other | Part#:RB211-535C-37 Serial#:30086<br>Hours:28899.07 Cycles:12486.00 Other:<br>Status:On Condition Part<br>Install Date:01/22/2018 |           |
| 72-10-02                               | Blade, LP Compressor   | UL19649  | 1ZBX  | 05  | Life Limit                                       |   |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00   |  |   | 16500.00  |  | 16500.00 C  | 2230.00 C |
| 72-10-02                               | Blade, LP Compressor   | UL19649  | 1ZST  | 06  | Life Limit                                       |   |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00   |  |   | 16500.00  |  | 16500.00 C  | 2230.00 C |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 2BUE  | 07  | Life Limit                                       |   |           |
| TSN: 6405.17<br>CSN: 3116.00<br>OSN:   | 11/07/1997<br>1449.40<br>736.00  |  |   | 12500.00  |  | 12500.00 C  | 9384.00 C |
| 72-10-02                               | Blade, LP Compressor   | UL19649  | 1ZKH  | 08  | Life Limit                                       |   |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00   |  |   | 16500.00  |  | 16500.00 C  | 2230.00 C |
| 72-10-02                               | Blade, LP Compressor   | UL19649  | 1XZW  | 09  | Life Limit                                       |   |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00   |  |   | 16500.00  |  | 16500.00 C  | 2230.00 C |
| 72-10-02                               | Blade, LP Compressor   | UL19649  | 1ZGN  | 10  | Life Limit                                       |   |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00   |  |   | 16500.00  |  | 16500.00 C  | 2230.00 C |



### 0 - RB211-535C-37 / 30086 - Turbofan/ - Life/Overhaul Limit Report

| ATA Number                             | Description  | Part Number  | Serial Number   | Position  | Status   | Next Due  | Remaining |
|--|--|--|---|---|--|---|-----------|
| Hours<br>Cycles<br>Other               | Date at Install<br>Hours at Install<br>Cycles at Install<br>Other at Install | Date at Overhaul<br>Hours at Overhaul<br>Cycles at Overhaul<br>Other at Overhaul | Hours Since Overhaul<br>Cycles Since Overhaul<br>Other Since Overhaul | Start Date<br>Limit Hours<br>Limit Cycles<br>Limit Days | TBO Hours<br>TBO Cycles<br>TBO Days<br>TBO Other | Part#:RB211-535C-37 Serial#:30086<br>Hours:28899.07 Cycles:12486.00 Other:<br>Status:On Condition Part<br>Install Date:01/22/2018 |           |
| 72-10-02                               | Blade, LP Compressor   | UL19649  | 1ZGK  | 11  | Life Limit                                       |   |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00   |  | 16500.00  |   |  | 16500.00 C  | 2230.00 C |
| 72-10-02                               | Blade, LP Compressor   | UL19649  | 1ZMU  | 12  | Life Limit                                       |   |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00   |  | 16500.00  |   |  | 16500.00 C  | 2230.00 C |
| 72-10-02                               | Blade, LP Compressor   | UL19649  | 1XMN  | 13  | Life Limit                                       |   |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00   |  | 16500.00  |   |  | 16500.00 C  | 2230.00 C |
| 72-10-02                               | Blade, LP Compressor   | UL19649  | 1XGW  | 14  | Life Limit                                       |   |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00   |  | 16500.00  |   |  | 16500.00 C  | 2230.00 C |
| 72-10-02                               | Blade, LP Compressor   | UL19649  | 1XUB  | 15  | Life Limit                                       |   |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00   |  | 16500.00  |   |  | 16500.00 C  | 2230.00 C |
| 72-10-02                               | Blade, LP Compressor   | UL19649  | 1ZMJ  | 16  | Life Limit                                       |   |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00   |  | 16500.00  |   |  | 16500.00 C  | 2230.00 C |





**0 - RB211-535C-37 / 30086 - Turbofan/ - Life/Overhaul Limit Report**

| ATA Number                             | Description                        | Part Number        |                       | Serial Number |            | Position  | Status | Next Due   | Remaining |
|--|------------------------------------|--------------------|-----------------------|---------------|------------|---|--------|------------|-----------|
| Hours                                  | Date at Install                    | Date at Overhaul   | Hours Since Overhaul  | Start Date    | TBO Hours  | Part#:RB211-535C-37 Serial#:30086<br>Hours:28899.07 Cycles:12486.00 Other:<br>Status:On Condition Part<br>Install Date:01/22/2018 |        |            |           |
| Cycles                                 | Hours at Install                   | Hours at Overhaul  | Cycles Since Overhaul | Limit Hours   | TBO Cycles |   |        |            |           |
| Other                                  | Cycles at Install                  | Cycles at Overhaul | Other Since Overhaul  | Limit Cycles  | TBO Days   |   |        |            |           |
|  | Other at Install                   | Other at Overhaul  |                       | Limit Days    | TBO Other  |   |        |            |           |
| 72-10-02                               | Blade, LP Compressor               | UL19649            | 1XRA                  | 17            | Life Limit |   |        |            |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00 |                    |                       | 16500.00      |            |   |        | 16500.00 C | 2230.00 C |
| 72-10-02                               | Blade, LP Compressor               | UL19649            | 1XMM                  | 18            | Life Limit |   |        |            |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00 |                    |                       | 16500.00      |            |   |        | 16500.00 C | 2230.00 C |
| 72-10-02                               | Blade, LP Compressor               | UL19649            | 1ZGJ                  | 19            | Life Limit |   |        |            |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00 |                    |                       | 16500.00      |            |   |        | 16500.00 C | 2230.00 C |
| 72-10-02                               | Blade, LP Compressor               | UL19649            | 1WMX                  | 20            | Life Limit |   |        |            |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00 |                    |                       | 16500.00      |            |   |        | 16500.00 C | 2230.00 C |
| 72-10-02                               | Blade, LP Compressor               | UL19657            | 1UDH                  | 21            | Life Limit |   |        |            |           |
| TSN: 37458.17<br>CSN: 17082.00<br>OSN: | 11/07/1997<br>32502.40<br>14702.00 |                    |                       | 20500.00      |            |   |        | 20500.00 C | 3418.00 C |
| 72-10-02                               | Blade, LP Compressor               | UL19649            | 1TNU                  | 22            | Life Limit |   |        |            |           |
| TSN: 35849.17<br>CSN: 14270.00<br>OSN: | 11/07/1997<br>30893.40<br>11890.00 |                    |                       | 16500.00      |            |   |        | 16500.00 C | 2230.00 C |





**0 - RB211-535C-37 / 30086 - Turbofan/ - Life/Overhaul Limit Report**

| ATA Number    | Description          | Part Number        |                       | Serial Number |            | Position                              | Status | Next Due   | Remaining |
|---------------|----------------------|--------------------|-----------------------|---------------|------------|---------------------------------------|--------|------------|-----------|
| Hours         | Date at Install      | Date at Overhaul   | Hours Since Overhaul  | Start Date    | TBO Hours  | Part#:RB211-535C-37 Serial#:30086     |        |            |           |
| Cycles        | Hours at Install     | Hours at Overhaul  | Cycles Since Overhaul | Limit Hours   | TBO Cycles | Hours:28899.07 Cycles:12486.00 Other: |        |            |           |
| Other         | Cycles at Install    | Cycles at Overhaul | Other Since Overhaul  | Limit Cycles  | TBO Days   | Status:On Condition Part              |        |            |           |
|               | Other at Install     | Other at Overhaul  |                       | Limit Days    | TBO Other  | Install Date:01/22/2018               |        |            |           |
| 72-10-02      | Blade, LP Compressor | UL19649            | 1ZEL                  | 23            | Life Limit |                                       |        |            |           |
| TSN: 35849.17 | 11/07/1997           |                    |                       |               |            |                                       |        |            |           |
| CSN: 14270.00 | 30893.40             |                    |                       | 16500.00      |            |                                       |        | 16500.00 C | 2230.00 C |
| OSN:          | 11890.00             |                    |                       |               |            |                                       |        |            |           |
| 72-10-02      | Blade, LP Compressor | UL19649            | 1ZBG                  | 24            | Life Limit |                                       |        |            |           |
| TSN: 35849.17 | 11/07/1997           |                    |                       |               |            |                                       |        |            |           |
| CSN: 14270.00 | 30893.40             |                    |                       | 16500.00      |            |                                       |        | 16500.00 C | 2230.00 C |
| OSN:          | 11890.00             |                    |                       |               |            |                                       |        |            |           |
| 72-10-02      | Blade, LP Compressor | UL19649            | 1XMR                  | 25            | Life Limit |                                       |        |            |           |
| TSN: 35849.17 | 11/07/1997           |                    |                       |               |            |                                       |        |            |           |
| CSN: 14270.00 | 30893.40             |                    |                       | 16500.00      |            |                                       |        | 16500.00 C | 2230.00 C |
| OSN:          | 11890.00             |                    |                       |               |            |                                       |        |            |           |
| 72-10-02      | Blade, LP Compressor | UL19649            | 1ZBH                  | 26            | Life Limit |                                       |        |            |           |
| TSN: 35849.17 | 11/07/1997           |                    |                       |               |            |                                       |        |            |           |
| CSN: 14270.00 | 30893.40             |                    |                       | 16500.00      |            |                                       |        | 16500.00 C | 2230.00 C |
| OSN:          | 11890.00             |                    |                       |               |            |                                       |        |            |           |
| 72-10-02      | Blade, LP Compressor | UL19649            | 1XTE                  | 27            | Life Limit |                                       |        |            |           |
| TSN: 35849.17 | 11/07/1997           |                    |                       |               |            |                                       |        |            |           |
| CSN: 14270.00 | 30893.40             |                    |                       | 16500.00      |            |                                       |        | 16500.00 C | 2230.00 C |
| OSN:          | 11890.00             |                    |                       |               |            |                                       |        |            |           |
| 72-10-02      | Blade, LP Compressor | UL19649            | 1ZJR                  | 28            | Life Limit |                                       |        |            |           |
| TSN: 35849.17 | 11/07/1997           |                    |                       |               |            |                                       |        |            |           |
| CSN: 14270.00 | 30893.40             |                    |                       | 16500.00      |            |                                       |        | 16500.00 C | 2230.00 C |
| OSN:          | 11890.00             |                    |                       |               |            |                                       |        |            |           |



**0 - RB211-535C-37 / 30086 - Turbofan/ - Life/Overhaul Limit Report**

| ATA Number    | Description                | Part Number        |                       | Serial Number |            | Position                              | Status | Next Due   | Remaining |
|---------------|----------------------------|--------------------|-----------------------|---------------|------------|---------------------------------------|--------|------------|-----------|
| Hours         | Date at Install            | Date at Overhaul   | Hours Since Overhaul  | Start Date    | TBO Hours  | Part#:RB211-535C-37 Serial#:30086     |        |            |           |
| Cycles        | Hours at Install           | Hours at Overhaul  | Cycles Since Overhaul | Limit Hours   | TBO Cycles | Hours:28899.07 Cycles:12486.00 Other: |        |            |           |
| Other         | Cycles at Install          | Cycles at Overhaul | Other Since Overhaul  | Limit Cycles  | TBO Days   | Status:On Condition Part              |        |            |           |
|               | Other at Install           | Other at Overhaul  |                       | Limit Days    | TBO Other  | Install Date:01/22/2018               |        |            |           |
| 72-10-02      | Blade, LP Compressor       | UL19649            | 1ZKM                  | 29            | Life Limit |                                       |        |            |           |
| TSN: 35849.17 | 11/07/1997                 |                    |                       |               |            |                                       |        |            |           |
| CSN: 14270.00 | 30893.40                   |                    |                       | 16500.00      |            |                                       |        | 16500.00 C | 2230.00 C |
| OSN:          | 11890.00                   |                    |                       |               |            |                                       |        |            |           |
| 72-10-02      | Blade, LP Compressor       | UL19649            | 1XWB                  | 30            | Life Limit |                                       |        |            |           |
| TSN: 35849.17 | 11/07/1997                 |                    |                       |               |            |                                       |        |            |           |
| CSN: 14270.00 | 30893.40                   |                    |                       | 16500.00      |            |                                       |        | 16500.00 C | 2230.00 C |
| OSN:          | 11890.00                   |                    |                       |               |            |                                       |        |            |           |
| 72-10-02      | Blade, LP Compressor       | UL19649            | 1XGX                  | 31            | Life Limit |                                       |        |            |           |
| TSN: 35849.17 | 11/07/1997                 |                    |                       |               |            |                                       |        |            |           |
| CSN: 14270.00 | 30893.40                   |                    |                       | 16500.00      |            |                                       |        | 16500.00 C | 2230.00 C |
| OSN:          | 11890.00                   |                    |                       |               |            |                                       |        |            |           |
| 72-10-02      | Blade, LP Compressor       | UL19649            | 1WEW                  | 32            | Life Limit |                                       |        |            |           |
| TSN: 35849.17 | 11/07/1997                 |                    |                       |               |            |                                       |        |            |           |
| CSN: 14270.00 | 30893.40                   |                    |                       | 16500.00      |            |                                       |        | 16500.00 C | 2230.00 C |
| OSN:          | 11890.00                   |                    |                       |               |            |                                       |        |            |           |
| 72-10-02      | Blade, LP Compressor       | UL19649            | 1XTH                  | 33            | Life Limit |                                       |        |            |           |
| TSN: 35849.17 | 11/07/1997                 |                    |                       |               |            |                                       |        |            |           |
| CSN: 14270.00 | 30893.40                   |                    |                       | 16500.00      |            |                                       |        | 16500.00 C | 2230.00 C |
| OSN:          | 11890.00                   |                    |                       |               |            |                                       |        |            |           |
| 72-10-03      | Shaft, LP Compressor Rotor | UL11417            | PATH1082              | Only          | Life Limit |                                       |        |            |           |
| TSN: 28899.07 | 01/15/1984                 |                    |                       |               |            |                                       |        |            |           |
| CSN: 12486.00 | 0                          |                    |                       | 19800.00      |            |                                       |        | 19800.00 C | 7314.00 C |
| OSN:          | 0                          |                    |                       |               |            |                                       |        |            |           |



**0 - RB211-535C-37 / 30086 - Turbofan/ - Life/Overhaul Limit Report**

| ATA Number                             | Description                           | Part Number        | Serial Number | Position   | Status                                | Next Due   | Remaining  |
|--|---------------------------------------|--------------------|---------------|------------|---------------------------------------|------------|------------|
| Hours                                  | Date at Install                       | Date at Overhaul   | Start Date    | TBO Hours  | Part#:RB211-535C-37 Serial#:30086     |            |            |
| Cycles                                 | Hours at Install                      | Hours at Overhaul  | Limit Hours   | TBO Cycles | Hours:28899.07 Cycles:12486.00 Other: |            |            |
| Other                                  | Cycles at Install                     | Cycles at Overhaul | Limit Cycles  | TBO Days   | Status:On Condition Part              |            |            |
|  | Other at Install                      | Other at Overhaul  | Limit Days    | TBO Other  | Install Date:01/22/2018               |            |            |
| 72-20-00                               | Module 02, IP Compressor              | M02605AA           | DM3092        | Only       | On Condition Part                     |            |            |
| TSN: 28899.07<br>CSN: 12486.00<br>OSN: | 01/15/1984                            |                    |               |            |                                       |            |            |
| 72-20-01                               | Shaft, LP Compressor Rotor Stages 1-6 | LK86341            | DN34771       | Only       | Life Limit                            |            |            |
| TSN: 28899.07<br>CSN: 12486.00<br>OSN: | 01/15/1984<br>0<br>0                  |                    | 21950.00      |            |                                       | 21950.00 C | 9464.00 C  |
| 72-30-00                               | Module 03, Intermediate Case          | M03603AA           | DM3091        | Only       | On Condition Part                     |            |            |
| TSN: 28899.07<br>CSN: 12486.00<br>OSN: | 01/15/1984                            |                    |               |            |                                       |            |            |
| 72-30-01                               | Shaft, IP Compressor Rear Stub        | UL18826            | EAGZ448       | Only       | Life Limit                            |            |            |
| TSN: 20874.67<br>CSN: 9562.00<br>OSN:  | 07/18/1987<br>0<br>0                  |                    | 19800.00      |            |                                       | 19800.00 C | 10238.00 C |
| 72-40-00                               | Module 04, High Pressure              | M04607AF           | DM3096        | Only       | On Condition Part                     |            |            |
| TSN: 28899.07<br>CSN: 12486.00<br>OSN: | 01/15/1984                            |                    |               |            |                                       |            |            |
| 72-40-01                               | Disc, HP Compressor Stages 1-2        | UL20062            | DN42612       | Only       | Life Limit                            |            |            |
| TSN: 20374.07<br>CSN: 11912.00<br>OSN: | 05/02/1994<br>5142.00<br>4508.00      |                    | 19800.00      |            |                                       | 19800.00 C | 7888.00 C  |



### 0 - RB211-535C-37 / 30086 - Turbofan/ - Life/Overhaul Limit Report

| ATA Number                             | Description  | Part Number  | Serial Number   | Position  | Status   | Next Due  | Remaining             |
|--|--|--|---|---|--|---|-----------------------|
| Hours<br>Cycles<br>Other               | Date at Install<br>Hours at Install<br>Cycles at Install<br>Other at Install | Date at Overhaul<br>Hours at Overhaul<br>Cycles at Overhaul<br>Other at Overhaul | Hours Since Overhaul<br>Cycles Since Overhaul<br>Other Since Overhaul | Start Date<br>Limit Hours<br>Limit Cycles<br>Limit Days | TBO Hours<br>TBO Cycles<br>TBO Days<br>TBO Other | Part#:RB211-535C-37 Serial#:30086<br>Hours:28899.07 Cycles:12486.00 Other:<br>Status:On Condition Part<br>Install Date:01/22/2018 |                       |
| 72-40-02                               | Disc, HP Compressor Stage 3  | UL29349  | DEBH5307  | Only  | Life Limit                                       |   |                       |
| TSN: 9258.37<br>CSN: 3265.00<br>OSN:   | 07/20/1987<br>29378.00<br>12439.00   |  |   | 22000.00  |  |   | 22000.00 C 18735.00 C |
| 72-40-03                               | Rotor, HP Compressor Rear Shaft  | LK84122  | DN35222   | Only  | Life Limit                                       |   |                       |
| TSN: 29755.37<br>CSN: 12633.00<br>OSN: | 07/20/1987<br>8881.00<br>3071.00   |  |   | 21300.00  |  |   | 21300.00 C 8667.00 C  |
| 72-40-04                               | Disc, Joint Flange Support   | LK47878  | PQEL437   | Only  | Life Limit                                       |   |                       |
| TSN: 29755.37<br>CSN: 12633.00<br>OSN: | 07/20/1987<br>8881.00<br>3071.00   |  |   | 20000.00  |  |   | 20000.00 C 7367.00 C  |
| 72-40-05                               | Disc, HP Turbine   | LK80622  | LQDY5813  | Only  | Life Limit                                       |   |                       |
| TSN: 43761.07<br>CSN: 17722.00<br>OSN: | 07/07/2005<br>41555.00<br>16644.00   |  |   | 20000.00  |  |   | 20000.00 C 2278.00 C  |
| 72-50-00                               | Module 05, IP/LP Turbine   | M05606AB   | DM3093  | Only  | On Condition Part                                |   |                       |
| TSN: 28899.07<br>CSN: 12486.00<br>OSN: | 01/15/1984   |  |   |   |  |   |                       |
| 72-50-02                               | Shaft, IP Turbine  | UL19436  | BAEF4285  | Only  | Life Limit                                       |   |                       |
| TSN: 23539.07<br>CSN: 13457.00<br>OSN: | 05/02/1994<br>8307.00<br>6053.00   |  |   | 20000.00  |  |   | 20000.00 C 6543.00 C  |





**0 - RB211-535C-37 / 30086 - Turbofan/ - Life/Overhaul Limit Report**

| ATA Number    | Description                   | Part Number        |                       | Serial Number |            | Position  | Status | Next Due   | Remaining |
|---------------|-------------------------------|--------------------|-----------------------|---------------|------------|---|--------|------------|-----------|
| Hours         | Date at Install               | Date at Overhaul   | Hours Since Overhaul  | Start Date    | TBO Hours  | Part#:RB211-535C-37 Serial#:30086<br>Hours:28899.07 Cycles:12486.00 Other:<br>Status:On Condition Part<br>Install Date:01/22/2018 |        |            |           |
| Cycles        | Hours at Install              | Hours at Overhaul  | Cycles Since Overhaul | Limit Hours   | TBO Cycles |   |        |            |           |
| Other         | Cycles at Install             | Cycles at Overhaul | Other Since Overhaul  | Limit Cycles  | TBO Days   |   |        |            |           |
|               | Other at Install              | Other at Overhaul  |                       | Limit Days    | TBO Other  |   |        |            |           |
| 72-50-03      | Shaft, LP Turbine             | LK77015            | BAEF3864              |               | Only       | Life Limit  |        |            |           |
| TSN: 28899.07 | 01/15/1984                    |                    |                       |               |            |   |        |            |           |
| CSN: 12486.00 | 0                             |                    |                       | 19800.00      |            |   |        | 19800.00 C | 7314.00 C |
| OSN:          | 0                             |                    |                       |               |            |   |        |            |           |
| 72-50-04      | Disc, LP Turbine Stage 1      | LK76781            | SEBH4998              |               | Only       | Life Limit  |        |            |           |
| TSN: 28899.07 | 01/15/1984                    |                    |                       |               |            |   |        |            |           |
| CSN: 12486.00 | 0                             |                    |                       | 20000.00      |            |   |        | 20000.00 C | 7514.00 C |
| OSN:          | 0                             |                    |                       |               |            |   |        |            |           |
| 72-50-05      | Disc, LP Turbine Stage 2      | LK82454            | SEBH4846              |               | Only       | Life Limit  |        |            |           |
| TSN: 28899.07 | 01/15/1984                    |                    |                       |               |            |   |        |            |           |
| CSN: 12486.00 | 0                             |                    |                       | 20000.00      |            |   |        | 20000.00 C | 7514.00 C |
| OSN:          | 0                             |                    |                       |               |            |   |        |            |           |
| 72-50-06      | Disc, LP Turbine Stage 3      | LK83853            | SEBJ3046              |               | Only       | Life Limit  |        |            |           |
| TSN: 28899.07 | 01/15/1984                    |                    |                       |               |            |   |        |            |           |
| CSN: 12486.00 | 0                             |                    |                       | 20750.00      |            |   |        | 20750.00 C | 8264.00 C |
| OSN:          | 0                             |                    |                       |               |            |   |        |            |           |
| 72-50-30      | Disc, IP Turbine              | LK76902            | EEBH3606              |               | Only       | Life Limit  |        |            |           |
| TSN: 28899.07 | 01/15/1984                    |                    |                       |               |            |   |        |            |           |
| CSN: 12486.00 | 0                             |                    |                       | 20000.00      |            |   |        | 20000.00 C | 7514.00 C |
| OSN:          | 0                             |                    |                       |               |            |   |        |            |           |
| 72-60-00      | Module 06, High Speed Gearbox | M06603AB           | DM3094                |               | Only       | On Condition Part   |        |            |           |
| TSN: 28899.07 | 01/15/1984                    |                    |                       |               |            |   |        |            |           |
| CSN: 12486.00 |                               |                    |                       |               |            |   |        |            |           |
| OSN:          |                               |                    |                       |               |            |   |        |            |           |





**0 - RB211-535C-37 / 30086 - Turbofan/ - Life/Overhaul Limit Report**

| ATA Number                             | Description  | Part Number  | Serial Number   | Position  | Status   | Next Due  | Remaining |
|--|--|--|---|---|--|---|-----------|
| Hours<br>Cycles<br>Other               | Date at Install<br>Hours at Install<br>Cycles at Install<br>Other at Install | Date at Overhaul<br>Hours at Overhaul<br>Cycles at Overhaul<br>Other at Overhaul | Hours Since Overhaul<br>Cycles Since Overhaul<br>Other Since Overhaul | Start Date<br>Limit Hours<br>Limit Cycles<br>Limit Days | TBO Hours<br>TBO Cycles<br>TBO Days<br>TBO Other | Part#:RB211-535C-37 Serial#:30086<br>Hours:28899.07 Cycles:12486.00 Other:<br>Status:On Condition Part<br>Install Date:01/22/2018 |           |
| 72-70-00                               | Module 07, LP Fan Casing   | M07605AA   | DM3086  | Only  | On Condition Part                                |   |           |
| TSN: 28899.07<br>CSN: 12486.00<br>OSN: | 01/15/1984   |  |   |   |  |   |           |



### N757SS - Selected Components Report

| ATA Number                             | Description  | Part Number  | Serial Number   | Position  | Overhaul Remain                                      | Life Remain   |
|--|--|--|---|---|--|---|
| Hours<br>Cycles<br>Other               | Date at Install<br>Hours at Install<br>Cycles at Install<br>Other at Install | Date at Overhaul<br>Hours at Overhaul<br>Cycles at Overhaul<br>Other at Overhaul | Hours Since Overhaul<br>Cycles Since Overhaul<br>Other Since Overhaul | Start Date<br>Limit Hours<br>Limit Cycles<br>Limit Days | TBO Hours<br>TBO Cycles<br>TBO Calendar<br>TBO Other | Model#:757-236 Serial#:22176<br>Hours:53554.50 Cycles:25098.00<br>Information Date:03/10/2020 |
| 72-10-00                               | Module 01, LP Compressor Fan   | M01605AB   | DM3069  |   |  | On Condition Part   |
| TSN: 15421.90<br>CSN: 12663.00<br>OSN: | 01/19/2018<br>15177.40<br>12537.00   |  |   |   |  |   |
| 72-10-01                               | Disk, LP Compressor Rotor  | UL19579  | STDK24437   |   |  | Life Limit  |
| TSN: 10015.00<br>CSN: 11899.00<br>OSN: | 01/19/2018<br>9770.50<br>11773.00  |  | 12500.00  |   |  | 601.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 2BXN  |   |  | Life Limit  |
| TSN: 11530.20<br>CSN: 10376.00<br>OSN: | 01/19/2018<br>11285.70<br>10250.00   |  | 12500.00  |   |  | 2,124.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7AGR  |   |  | Life Limit  |
| TSN: 15619.80<br>CSN: 11941.00<br>OSN: | 01/19/2018<br>15375.30<br>11815.00   |  | 12500.00  |   |  | 559.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7AKK  |   |  | Life Limit  |
| TSN: 13179.30<br>CSN: 11009.00<br>OSN: | 01/19/2018<br>12934.80<br>10883.00   |  | 12500.00  |   |  | 1,491.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7AKW  |   |  | Life Limit  |
| TSN: 15619.80<br>CSN: 11941.00<br>OSN: | 01/19/2018<br>15375.30<br>11815.00   |  | 12500.00  |   |  | 559.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7ALZ  |   |  | Life Limit  |
| TSN: 15619.80<br>CSN: 11941.00<br>OSN: | 01/19/2018<br>15375.30<br>11815.00   |  | 12500.00  |   |  | 559.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7AMK  |   |  | Life Limit  |
| TSN: 15619.80<br>CSN: 11941.00<br>OSN: | 01/19/2018<br>15375.30<br>11815.00   |  | 12500.00  |   |  | 559.00 C  |



### N757SS - Selected Components Report

| ATA Number                             | Description  | Part Number  | Serial Number   | Position  | Overhaul Remain                                      | Life Remain   |
|--|--|--|---|---|--|---|
| Hours<br>Cycles<br>Other               | Date at Install<br>Hours at Install<br>Cycles at Install<br>Other at Install | Date at Overhaul<br>Hours at Overhaul<br>Cycles at Overhaul<br>Other at Overhaul | Hours Since Overhaul<br>Cycles Since Overhaul<br>Other Since Overhaul | Start Date<br>Limit Hours<br>Limit Cycles<br>Limit Days | TBO Hours<br>TBO Cycles<br>TBO Calendar<br>TBO Other | Model#:757-236 Serial#:22176<br>Hours:53554.50 Cycles:25098.00<br>Information Date:03/10/2020 |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7AMM  |   |  | Life Limit  |
| TSN: 15619.80<br>CSN: 11941.00<br>OSN: | 01/19/2018<br>15375.30<br>11815.00   |  |   | 12500.00  |  | 559.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7AMT  |   |  | Life Limit  |
| TSN: 15619.80<br>CSN: 11941.00<br>OSN: | 01/19/2018<br>15375.30<br>11815.00   |  |   | 12500.00  |  | 559.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7ARS  |   |  | Life Limit  |
| TSN: 15619.80<br>CSN: 11941.00<br>OSN: | 01/19/2018<br>15375.30<br>11815.00   |  |   | 12500.00  |  | 559.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7ARZ  |   |  | Life Limit  |
| TSN: 15619.80<br>CSN: 11941.00<br>OSN: | 01/19/2018<br>15375.30<br>11815.00   |  |   | 12500.00  |  | 559.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7ASA  |   |  | Life Limit  |
| TSN: 15619.80<br>CSN: 11941.00<br>OSN: | 01/19/2018<br>15375.30<br>11815.00   |  |   | 12500.00  |  | 559.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7ASB  |   |  | Life Limit  |
| TSN: 15619.80<br>CSN: 11941.00<br>OSN: | 01/19/2018<br>15375.30<br>11815.00   |  |   | 12500.00  |  | 559.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7ASJ  |   |  | Life Limit  |
| TSN: 15619.80<br>CSN: 11941.00<br>OSN: | 15375.30<br>11815.00   |  |   | 12500.00  |  | 559.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7ASM  |   |  | Life Limit  |
| TSN: 15619.80<br>CSN: 11941.00<br>OSN: | 01/19/2018<br>15375.30<br>11815.00   |  |   | 12500.00  |  | 559.00 C  |



### N757SS - Selected Components Report

| ATA Number                             | Description  | Part Number  | Serial Number   | Position  | Overhaul Remain                                      | Life Remain   |
|--|--|--|---|---|--|---|
| Hours<br>Cycles<br>Other               | Date at Install<br>Hours at Install<br>Cycles at Install<br>Other at Install | Date at Overhaul<br>Hours at Overhaul<br>Cycles at Overhaul<br>Other at Overhaul | Hours Since Overhaul<br>Cycles Since Overhaul<br>Other Since Overhaul | Start Date<br>Limit Hours<br>Limit Cycles<br>Limit Days | TBO Hours<br>TBO Cycles<br>TBO Calendar<br>TBO Other | Model#:757-236 Serial#:22176<br>Hours:53554.50 Cycles:25098.00<br>Information Date:03/10/2020 |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7ATA  |   |  | Life Limit  |
| TSN: 15619.80<br>CSN: 11941.00<br>OSN: | 01/19/2018<br>15375.30<br>11815.00   |  |   | 12500.00  |  | 559.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7ATB  |   |  | Life Limit  |
| TSN: 15619.80<br>CSN: 11941.00<br>OSN: | 01/19/2018<br>15375.30<br>11815.00   |  |   | 12500.00  |  | 559.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7ATE  |   |  | Life Limit  |
| TSN: 15619.80<br>CSN: 11941.00<br>OSN: | 01/19/2018<br>15375.30<br>11815.00   |  |   | 12500.00  |  | 559.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7ATN  |   |  | Life Limit  |
| TSN: 15619.80<br>CSN: 11941.00<br>OSN: | 01/19/2018<br>15375.30<br>11815.00   |  |   | 12500.00  |  | 559.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7AUW  |   |  | Life Limit  |
| TSN: 3404.10<br>CSN: 2698.00<br>OSN:   | 01/19/2018<br>3159.60<br>2572.00   |  |   | 12500.00  |  | 9,802.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7DUN  |   |  | Life Limit  |
| TSN: 8827.40<br>CSN: 7191.00<br>OSN:   | 01/19/2018<br>8582.90<br>7065.00   |  |   | 12500.00  |  | 5,309.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7DZB  |   |  | Life Limit  |
| TSN: 8827.40<br>CSN: 7191.00<br>OSN:   | 01/19/2018<br>8582.90<br>7065.00   |  |   | 12500.00  |  | 5,309.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7DZG  |   |  | Life Limit  |
| TSN: 8827.40<br>CSN: 7191.00<br>OSN:   | 01/19/2018<br>8582.90<br>7065.00   |  |   | 12500.00  |  | 5,309.00 C  |





### N757SS - Selected Components Report

| ATA Number                           | Description  | Part Number  | Serial Number   | Position  | Overhaul Remain                                      | Life Remain   |
|--------------------------------------|--|--|---|---|--|---|
| Hours<br>Cycles<br>Other             | Date at Install<br>Hours at Install<br>Cycles at Install<br>Other at Install | Date at Overhaul<br>Hours at Overhaul<br>Cycles at Overhaul<br>Other at Overhaul | Hours Since Overhaul<br>Cycles Since Overhaul<br>Other Since Overhaul | Start Date<br>Limit Hours<br>Limit Cycles<br>Limit Days | TBO Hours<br>TBO Cycles<br>TBO Calendar<br>TBO Other | Model#:757-236 Serial#:22176<br>Hours:53554.50 Cycles:25098.00<br>Information Date:03/10/2020 |
| 72-10-02                             | Blade, LP Compressor   | UL22327  | 7DZK  |   |  | Life Limit  |
| TSN: 8827.40<br>CSN: 7191.00<br>OSN: | 01/19/2018<br>8582.90<br>7065.00   |  |   | 12500.00  |  | 5,309.00 C  |
| 72-10-02                             | Blade, LP Compressor   | UL22327  | 7DZR  |   |  | Life Limit  |
| TSN: 8827.40<br>CSN: 7191.00<br>OSN: | 01/19/2018<br>8582.90<br>7065.00   |  |   | 12500.00  |  | 5,309.00 C  |
| 72-10-02                             | Blade, LP Compressor   | UL22327  | 7EAU  |   |  | Life Limit  |
| TSN: 8827.40<br>CSN: 7191.00<br>OSN: | 01/19/2018<br>8582.90<br>7065.00   |  |   | 12500.00  |  | 5,309.00 C  |
| 72-10-02                             | Blade, LP Compressor   | UL22327  | 7GTT  |   |  | Life Limit  |
| TSN: 3240.40<br>CSN: 2569.00<br>OSN: | 01/19/2018<br>2995.90<br>2443.00   |  |   | 12500.00  |  | 9,931.00 C  |
| 72-10-02                             | Blade, LP Compressor   | UL22327  | 7JSD  |   |  | Life Limit  |
| TSN: 3240.40<br>CSN: 2569.00<br>OSN: | 01/19/2018<br>2995.90<br>2443.00   |  |   | 12500.00  |  | 9,931.00 C  |
| 72-10-02                             | Blade, LP Compressor   | UL22327  | 7KLM  |   |  | Life Limit  |
| TSN: 3404.10<br>CSN: 2698.00<br>OSN: | 01/19/2018<br>3159.60<br>2572.00   |  |   | 12500.00  |  | 9,802.00 C  |
| 72-10-02                             | Blade, LP Compressor   | UL22327  | 7KLW  |   |  | Life Limit  |
| TSN: 3368.40<br>CSN: 2668.00<br>OSN: | 01/19/2018<br>3123.90<br>2542.00   |  |   | 12500.00  |  | 9,832.00 C  |
| 72-10-02                             | Blade, LP Compressor   | UL22327  | 7KRK  |   |  | Life Limit  |
| TSN: 3240.40<br>CSN: 2569.00<br>OSN: | 01/19/2018<br>2995.90<br>2443.00   |  |   | 12500.00  |  | 9,931.00 C  |





### N757SS - Selected Components Report

| ATA Number                             | Description  | Part Number  | Serial Number   | Position  | Overhaul Remain                                      | Life Remain   |
|--|--|--|---|---|--|---|
| Hours<br>Cycles<br>Other               | Date at Install<br>Hours at Install<br>Cycles at Install<br>Other at Install | Date at Overhaul<br>Hours at Overhaul<br>Cycles at Overhaul<br>Other at Overhaul | Hours Since Overhaul<br>Cycles Since Overhaul<br>Other Since Overhaul | Start Date<br>Limit Hours<br>Limit Cycles<br>Limit Days | TBO Hours<br>TBO Cycles<br>TBO Calendar<br>TBO Other | Model#:757-236 Serial#:22176<br>Hours:53554.50 Cycles:25098.00<br>Information Date:03/10/2020 |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7KUG  |   |  | Life Limit  |
| TSN: 3404.10<br>CSN: 2698.00<br>OSN:   | 01/19/2018<br>3159.60<br>2572.00   |  |   | 12500.00  |  | 9,802.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7KXG  |   |  | Life Limit  |
| TSN: 3368.40<br>CSN: 2668.00<br>OSN:   | 01/19/2018<br>3123.90<br>2542.00   |  |   | 12500.00  |  | 9,832.00 C  |
| 72-10-02                               | Blade, LP Compressor   | UL22327  | 7LJB  |   |  | Life Limit  |
| TSN: 3404.10<br>CSN: 2698.00<br>OSN:   | 01/19/2018<br>3159.60<br>2572.00   |  |   | 12500.00  |  | 9,802.00 C  |
| 72-10-03                               | Shaft, LP Compressor Rotor   | UL11449  | PATH913   |   |  | Life Limit  |
| TSN: 15421.90<br>CSN: 14048.00<br>OSN: | 01/19/2018<br>15177.40<br>13922.00   |  |   | 19800.00  |  | 5,752.00 C  |
| 72-20-00                               | Module 02, IP Compressor   | M02605AA   | DM3069  |   |  | On Condition Part   |
| TSN: 15421.90<br>CSN: 12663.00<br>OSN: | 01/19/2018<br>15177.40<br>12537.00   |  |   |   |  |   |
| 72-20-01                               | Shaft, LP Compressor Rotor Stages 1-6  | LK86341  | DN33956   |   |  | Life Limit  |
| TSN: 15421.90<br>CSN: 14048.00<br>OSN: | 01/19/2018<br>15177.40<br>13922.00   |  |   | 21950.00  |  | 7,902.00 C  |
| 72-30-00                               | Module 03, Intermediate Case   | M03603AA   | DM3033  |   |  | On Condition Part   |
| TSN: 43615.40<br>CSN: 32728.00<br>OSN: | 01/19/2018<br>43370.90<br>32602.00   |  |   |   |  |   |
| 72-30-01                               | Shaft, IP Compressor Rear Stub   | LK87323  | PAVR228A  |   |  | Life Limit  |
| TSN: 3589.60<br>CSN: 16000.00<br>OSN:  | 01/19/2018<br>3345.10<br>15874.00  |  |   | 19800.00  |  | 3,800.00 C  |



### N757SS - Selected Components Report

| ATA Number                             | Description                          | Part Number        | Serial Number         | Position     | Overhaul Remain | Life Remain                    |
|--|--------------------------------------|--------------------|-----------------------|--------------|-----------------|--------------------------------|
| Hours                                  | Date at Install                      | Date at Overhaul   | Hours Since Overhaul  | Start Date   | TBO Hours       | Model#:757-236 Serial#:22176   |
| Cycles                                 | Hours at Install                     | Hours at Overhaul  | Cycles Since Overhaul | Limit Hours  | TBO Cycles      | Hours:53554.50 Cycles:25098.00 |
| Other                                  | Cycles at Install                    | Cycles at Overhaul | Other Since Overhaul  | Limit Cycles | TBO Calendar    | Information Date:03/10/2020    |
|  | Other at Install                     | Other at Overhaul  |                       | Limit Days   | TBO Other       |                                |
| 72-40-00                               | Module 04, High Pressure             | M04607AF           | DM3061                |              |                 | On Condition Part              |
| TSN: 39804.40<br>CSN: 33049.00<br>OSN: | 01/19/2018<br>39559.90<br>32923.00   |                    |                       |              |                 |                                |
| 72-40-01                               | Disc, HP Compressor Rotor Stages 1-2 | UL20062            | MW0424572             |              |                 | Life Limit                     |
| TSN: 3589.60<br>CSN: 2856.00<br>OSN:   | 01/19/2018<br>3345.10<br>2730.00     |                    | 19800.00              |              |                 | 16,944.00 C                    |
| 72-40-02                               | Disc, HP Compressor Rotor Stage 3    | UL24738            | SETM26094             |              |                 | Life Limit                     |
| TSN: 3589.60<br>CSN: 2856.00<br>OSN:   | 01/19/2018<br>3345.10<br>2730.00     |                    | 15000.00              |              |                 | 12,144.00 C                    |
| 72-40-03                               | Rotor, HP Compressor 4-6 Rotor Shaft | UL32173            | DN65034               |              |                 | Life Limit                     |
| TSN: 17475.40<br>CSN: 13542.00<br>OSN: | 01/19/2018<br>17230.90<br>13146.00   |                    | 21300.00              |              |                 | 7,758.00 C                     |
| 72-40-04                               | Disc, Compressor/Turbine Support     | LK47878            | PQEL2107              |              |                 | Life Limit                     |
| TSN: 14753.40<br>CSN: 11105.00<br>OSN: | 01/19/2018<br>14508.90<br>10979.00   |                    | 20000.00              |              |                 | 8,895.00 C                     |
| 72-40-05                               | Disc, HP Turbine                     | UL28267            | LDRCZ12425            |              |                 | Life Limit                     |
| TSN: 17475.40<br>CSN: 13272.00<br>OSN: | 01/19/2018<br>17230.90<br>13146.00   |                    | 19290.00              |              |                 | 6,018.00 C                     |
| 72-50-00                               | Module 05, IP/LP Turbine             | M05606AC           | DM3095                |              |                 | On Condition Part              |
| TSN: 38875.70<br>CSN: 34141.00<br>OSN: | 01/19/2018<br>38631.20<br>34015.00   |                    |                       |              |                 |                                |
| 72-50-02                               | Shaft, IP Turbine                    | UL37569            | PAEF4219              |              |                 | Life Limit                     |
| TSN: 6921.00<br>CSN: 5631.00<br>OSN:   | 01/19/2018<br>6676.50<br>5505.00     |                    | 20000.00              |              |                 | 14,369.00 C                    |



### N757SS - Selected Components Report

| ATA Number                             | Description                         | Part Number        | Serial Number | Position     | Overhaul Remain                | Life Remain       |
|--|-------------------------------------|--------------------|---------------|--------------|--------------------------------|-------------------|
| Hours                                  | Date at Install                     | Date at Overhaul   | Start Date    | TBO Hours    | Model#:757-236 Serial#:22176   |                   |
| Cycles                                 | Hours at Install                    | Hours at Overhaul  | Limit Hours   | TBO Cycles   | Hours:53554.50 Cycles:25098.00 |                   |
| Other                                  | Cycles at Install                   | Cycles at Overhaul | Limit Cycles  | TBO Calendar | Information Date:03/10/2020    |                   |
|  | Other at Install                    | Other at Overhaul  | Limit Days    | TBO Other    |                                |                   |
| 72-50-03                               | Shaft, LP Turbine                   | UL19432            | BAEF4056/A    |              |                                | Life Limit        |
| TSN: 21100.70<br>CSN: 16958.00<br>OSN: | 01/19/2018<br>20856.20<br>16832.00  |                    | 19800.00      |              |                                | 2,842.00 C        |
| 72-50-04                               | Disc, LP Turbine Stage 1            | UL28292            | SETM10052     |              |                                | Life Limit        |
| TSN: 8410.86<br>CSN: 6323.00<br>OSN:   | 01/19/2018<br>8166.60<br>6197.00    |                    | 20000.00      |              |                                | 13,677.00 C       |
| 72-50-05                               | Disc, LP Turbine Stage 2            | UL28294            | SETM10210     |              |                                | Life Limit        |
| TSN: 16122.00<br>CSN: 13796.00<br>OSN: | 01/19/2018<br>15877.50<br>13670.00  |                    | 20000.00      |              |                                | 6,204.00 C        |
| 72-50-06                               | Disc, LP Turbine Stage 3            | UL37657            | SEBJ3125      |              |                                | Life Limit        |
| TSN: 21100.70<br>CSN: 16958.00<br>OSN: | 01/19/2018<br>20856.20<br>16832.00  |                    | 20750.00      |              |                                | 3,792.00 C        |
| 72-50-30                               | Disc, LP Turbine                    | UL28291            | EEBH7480      |              |                                | Life Limit        |
| TSN: 6921.00<br>CSN: 5631.00<br>OSN:   | 01/19/2018<br>6676.50<br>5505.00    |                    | 20000.00      |              |                                | 14,369.00 C       |
| 72-60-00                               | Module 06, High Speed Gearbox       | M06603AB           | DM3034        |              |                                | On Condition Part |
| TSN: 42598.80<br>CSN: 32075.00<br>OSN: | 01/19/2018<br>42354.30<br>31949.00  |                    |               |              |                                |                   |
| 72-70-00                               | Module 07, LP Compressor Fan Casing | M07604AC           | DM3004        |              |                                | On Condition Part |
| TSN: 41568.40<br>CSN: 31348.00<br>OSN: | 01/19/2018<br>41323.90<br>31222.00  |                    |               |              |                                |                   |

